


Orange

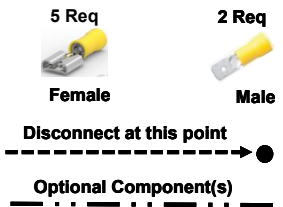

Step 1) Follow Red Compressor wire **FROM** Compressor **TO** Contactor Block **T1** terminal, Disconnect, cut fork connector off, Crimp female on Red Compressor wire, Connect to Blue Softstart wire, Tape or use shrink sleeve on connection.

Step 3) Connect Yellow Softstart wire on a empty Run Capacitor "H" Herm terminal next to the Orange Compressor wire

Step 5) Follow Blk/Blu Compressor wire **FROM** Compressor **TO** Contactor Block **T2** terminal, Disconnect cut fork terminal off, Crimp female on Blk/Blu Compressor wire. Connect to Brown Softstart wire, Tape or use shrink sleeve on connection.

Turn Power ON, Set Tstat to 55F, Turn AC ON, Look at Softstart Run Led 1 will be Green when compressor is running, Green light ON, shut AC down
Replace cover, Turn AC back ON raise Tstat just below current inside temp run 30 min. After 30 min operate normally

Wiring Diagram for American Standard Home AC D159478P01 Rev A

Copyright © 2026 NetworkRV LLC. All Rights Reserved.